

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 6320	Street Vineyard Dr.	City Paso Robles	ZIP 93446	Date of Inspection 08/27/2021	Number of Pages 5
----------------------	------------------------	---------------------	--------------	----------------------------------	----------------------



STORY TERMITE & PEST
P.O. BOX 2796
 Atascadero CA 93423
 (805) 347-4707 (805) 460-0650
 Storytermite@gmail.com

Report # : 13059
 Registration # : PR 6987
 Escrow # :
☐ CORRECTED REPORT

Ordered by: Devon Pitts Re/Max Parkside 711 12th St Paso Robles CA 93446	Property Owner and/or Party of Interest:	Report sent to:
--	--	-----------------


COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐

GENERAL DESCRIPTION: FURNISHED AND OCCUPIED ONE STORY WOOD SIDED RESIDENCE WITH ATTACHED GARAGE ON A RAISED FOUNDATION AND COMP ROOF	Inspection Tag Posted: Meter Box Other Tags Posted:
---	---

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☐ Drywood Termites ☒ Fungus / Dryrot ☒ Other Findings ☒ Further Inspection ☐
 If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

Diagram Not To Scale

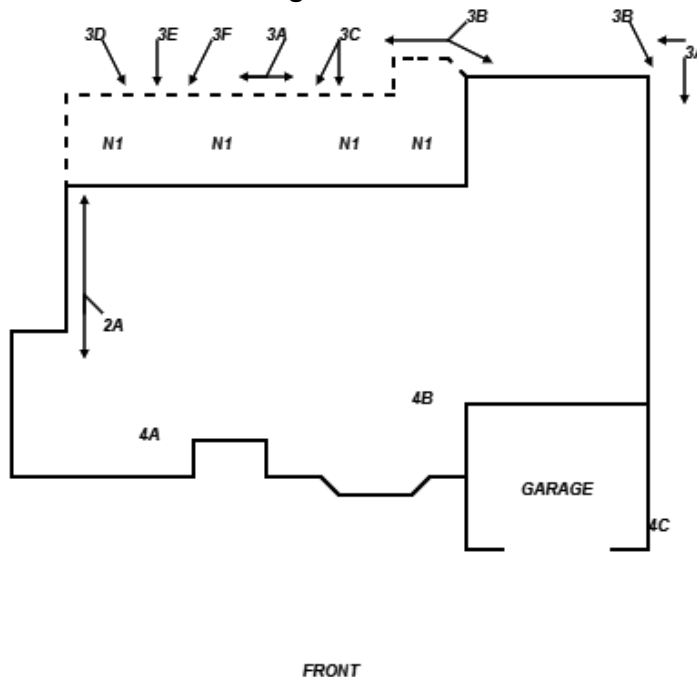

Inspected By: Dave Story State License No. OPR10259 Signature: [Signature]

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

STORY TERMITE & PEST

Page 2 of 5 inspection report

6320	Vineyard Dr.	Paso Robles	CA	93446
Address of Property Inspected		City	State	ZIP
08/27/2021	13059			
Date of Inspection	Corresponding Report No.		Escrow No.	

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

STORY TERMITE & PEST

Page 3 of 5 inspection report

6320	Vineyard Dr.	Paso Robles	CA	93446
Address of Property Inspected		City	State	ZIP
08/27/2021	13059			
Date of Inspection		Corresponding Report No.		Escrow No.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

SECTION I:

2A - Drywood

FINDING-Evidence of Drywood termite infestation noted at the substructure framing. Infestation appears to extend into inaccessible wall framing.

RECOMMENDATION-Vacate and seal the entire structure. Fumigate with the registered fumigant Vikane (Sulfuryl Fluoride). Chloropicrin to be used as the warning agent. Remove the seals and aerate the structure ready for occupancy.

The fumigation cannot be done in strong winds or rain and will be rescheduled if there is inclement weather.

Remove or cover evidence of dry wood termites.

3A - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the fascia boards and rafter tails of the eave framing.

RECOMMENDATION- Remove and replace damaged wood members as necessary. Paint areas to a reasonable match. (Estimate is for the visible damage)

3B - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the wood siding and trim boards.

RECOMMENDATION-Remove and replace damaged wood members as necessary. Paint areas to a reasonable match. (Estimate is for the visible damage)

IF DAMAGE EXTENDS INTO INACCESSIBLE AREAS, A SUPPLEMENTAL INSPECTION WILL BE MADE AND REPORT ISSUED OUTLINING OUR FINDINGS, RECOMMENDATIONS, AND ANY ADDITIONAL COST.

3C - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the wooden french doors.

RECOMMENDATION- Remove and replace doors and door jambs with a new pre-hung door unit.

3D - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the 8x8 post of the wall framing.

RECOMMENDATION- Remove and replace damaged wood members as necessary. Paint areas to a reasonable match. (Estimate is for the visible damage)

3E - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the french door.

RECOMMENDATION-Remove and replace door, reusing existing hardware.

STORY TERMITE & PEST

Page 4 of 5 inspection report

6320	Vineyard Dr.	Paso Robles	CA	93446
Address of Property Inspected		City	State	ZIP
08/27/2021	13059			
Date of Inspection		Corresponding Report No.		Escrow No.

3F - Fungus / Dryrot

FINDING-Fungus infection and damage noted at the 6x6 beam of the wall framing.

RECOMMENDATION-Remove and replace damaged wood members as necessary. Paint areas to a reasonable match.
(Estimate is for the visible damage)

IF DAMAGE EXTENDS INTO INACCESSIBLE AREAS, A SUPPLEMENTAL INSPECTION WILL BE MADE AND REPORT ISSUED OUTLINING OUR FINDINGS, RECOMMENDATIONS, AND ANY ADDITIONAL COST.

SECTION II:

4A - Other Findings

FINDING- Loose toilet noted at the hall bathroom.

RECOMMENDATION- Remove toilet. Install new seal and reset toilet.

If damage extends into subfloor or if Plumbing requiring repair is disclosed, a Supplemental Inspection report will be made and report issued outlining our findings, recommendations, and any additional costs.

4B - Other Findings

FINDING- Water stains noted at the attic framing. It could not be determined if stains are caused from previous or current leakage.

RECOMMENDATION- Owner to consult a licensed roofer for further inspection and recommendation.

4C - Other Findings

FINDING- Earth wood contacts noted at the attached fence/gate.

RECOMMENDATION- Install metal flashing between house and fence post as necessary to eliminate earth wood contact.

NOTES:

Note A

Note- A raised wood floor has been constructed over a concrete slab, making the area under the flooring inaccessible for inspection. No visible evidence of active infestation or infection noted to warrant further inspection.

Recommendations not being performed by Story Termite & Pest must be inspected during the progress by a licensed Wood-destroying Pest and Organism Inspector. Story Termite & Pest is not responsible for, nor implies any knowledge as to the quality of work performed by others.

BY RELYING ON THIS WOOD DESTROYING ORGANISM REPORT YOU AGREE THAT ANY CONTROVERSY OR CLAIM ARISING OUT OF OR RELATING TO STORY TERMITE & PEST INSPECTION AND/OR THIS REPORT SHALL BE SETTLED BY ARBITRATION IN ACCORDANCE WITH THE CONSTRUCTION INDUSTRY ARBITRATION RULES OF THE AMERICAN ARBITRATION ASSOCIATION, AND JUDGMENT UPON THE AWARD RENDERED BY THE ARBITRATOR(S) MAY BE ENTERED IN ANY COURT HAVING JURISDICTION THEREOF.

THANK YOU FOR CHOOSING STORY TERMITE & PEST. IF YOU HAVE ANY QUESTIONS OR CONCERNS PLEASE CONTACT US AT 805-347-4707

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

STORY TERMITE & PEST

Page 5 of 5 inspection report

6320	Vineyard Dr.	Paso Robles	CA	93446
Address of Property Inspected		City	State	ZIP
08/27/2021	13059			
Date of Inspection	Corresponding Report No.		Escrow No.	

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(805) 781-5910
Health Department	(805) 781-5500
Structural Pest Control Board	(916) 561-8700
2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815	



STORY TERMITE & PEST

P.O. BOX 2796

Atascadero CA 93423

(805) 347-4707 (805) 460-0650

Storytermite@gmail.com

Page 1 of 1

WORK AUTHORIZATION

Report #: 13059

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 6320 Vineyard Dr.

City: Paso Robles

State/ZIP: CA 93446

The inspection report of the company dated, **08/27/2021** is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____. This total amount is due and payable within days from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of **ninety (90) days**. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof.

THE OWNER OR OWNER'S AGENT AGREES

To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

ITEMS

Prefix	Section I	Section II	Further Inspection	Other
2A	3,900.00	0.00	0.00	0.00
3A	Refer to Contractor	0.00	0.00	0.00
3B	Combine w/3A	0.00	0.00	0.00
3C	Combine w/3A	0.00	0.00	0.00
3D	Combine w/3A	0.00	0.00	0.00
3E	Combine w/3A	0.00	0.00	0.00
3F	Combine w/3A	0.00	0.00	0.00
4A	0.00	Refer to Plumber	0.00	0.00
4B	0.00	Refer to Roofer	0.00	0.00
4C	0.00	Refer to Contractor	0.00	0.00
Total:	3,900.00	0.00	0.00	0.00

GRAND TOTAL: 3,900.00

Property Owner:

Date:

Inspected By:

Date:

Owner's Agent:

Date:



INVOICE / STATEMENT

STORY TERMITE & PEST

P.O. BOX 2796

Atascadero CA 93423

(805) 347-4707 (805) 460-0650

Storytermite@gmail.com

Date: 08/27/2021

Report Number: 13059

Invoice Number: 13059-1

Escrow Number:

Property 6320 Vineyard Dr.
Inspected: Paso Robles, CA 93446

Bill To: Devon Pitts
Re/Max Parkside
711 12th St
Paso Robles, CA 93446

(805) 674-3771
devonpitts13@gmail.com

Inspection fee: \$	125.00
Invoice Total: \$	125.00
Payments: \$	0.00
Total Due: \$	125.00

Description of Service

RETAIN THIS COPY FOR YOUR RECORDS

We appreciate your business!

CUT HERE

CUT HERE

CUT HERE



INVOICE / STATEMENT

STORY TERMITE & PEST

P.O. BOX 2796

Atascadero CA 93423

(805) 347-4707 (805) 460-0650

Storytermite@gmail.com

Date: 08/27/2021

Report Number: 13059

Invoice Number: 13059-1

Escrow Number:

Property 6320 Vineyard Dr.
Inspected: Paso Robles, CA 93446

Bill To: Devon Pitts
Re/Max Parkside
711 12th St
Paso Robles, CA 93446

(805) 674-3771
devonpitts13@gmail.com

Inspection fee: \$	125.00
Invoice Total: \$	125.00
Payments: \$	0.00
Total Due: \$	125.00

Description of Service

RETURN THIS COPY WITH REMITTANCE

We appreciate your business!