Summary of all deficient items not functioning as intended

- 1. Rain diverters over One of the HVAC units appears to be inadequate. Recommend replacing with gutter.
- 2. Several of the cornice flashing/pest control covers appear to be damaged or missing. Signs of bird and small rodent activity found in attic.
- 3. Attic access doors are not solid core/insulated and do not seal.
- 4. Stairway hand rail and guard rail not present. This has now been added -
- 5. Laundry room counter top above washer/dryer is not attached.
- 6. 2 back porch ceiling fans did not appear to function. May be on remotes? on Remote
- 7. One kitchen under cabinet light did not function.
- 8. One HVAC coolant line sleeve is damaged at the exterior.
- 9. Master bath tub valves are leaking at the stems. Water is pooling on tub deck.
- 10. Laundry room sink aerator is missing, causing water to splash out of basin and onto counters, cabinets, and floor.
- 11. Master shower appears to pond water. Poor slope. This hasbeen completely su-close
- 12. Water heater 2 is disconnected from power, Water valve is shut off, and cover plates for heating elements are removed. One water heater appears to be abandoned. This Ras been Connected New hot
- Water heater has here westalled _ 13. Recirculation plumbing loop between water heaters shows multiple areas of corrosion. Recirculation pump is funning excessively hot.
- 14. Therapy tub access to mechanicals is not present.
- 15. Therapy tub on /off switch is damaged, but still functions. Light switch must be on for the unit to operate.
- 16. Multiple exhaust fans have come loose from roof terminations. Vents are now terminating in the attic.
- 17. Garage door locking mechanisms should be disabled when an opener are in use. Remove or disable garage door locks.