

Soils for Parcel
2

SOIL EVALUATION DATA SHEET

Ingham County Health Department
P. O. Box 30161 Lansing, Michigan 48909

THIS RECORD SHALL NOT CONSTITUTE A PERMIT

Requested by ROBERT & ANN GOOD

Address 1514 ROLFE RD
MASON, 48854

Phone # 676-5961

- ☒ Land Owner ☐ Realtor
☐ Prospective Buyer ☐ Builder
☐ Installer ☐ Other:

Township VEVAY Section 27

Road Location NW corner of Ives Rd
and Rolfe Rd

Subdivision _____


Lot No. _____ Side of Road NW

File Search _____


Parcel No. 33- _____

Soil Survey Sheet No. _____

Parcel Size 4.0 ac

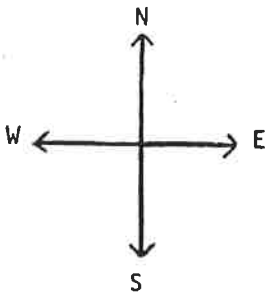

PLOT PLAN

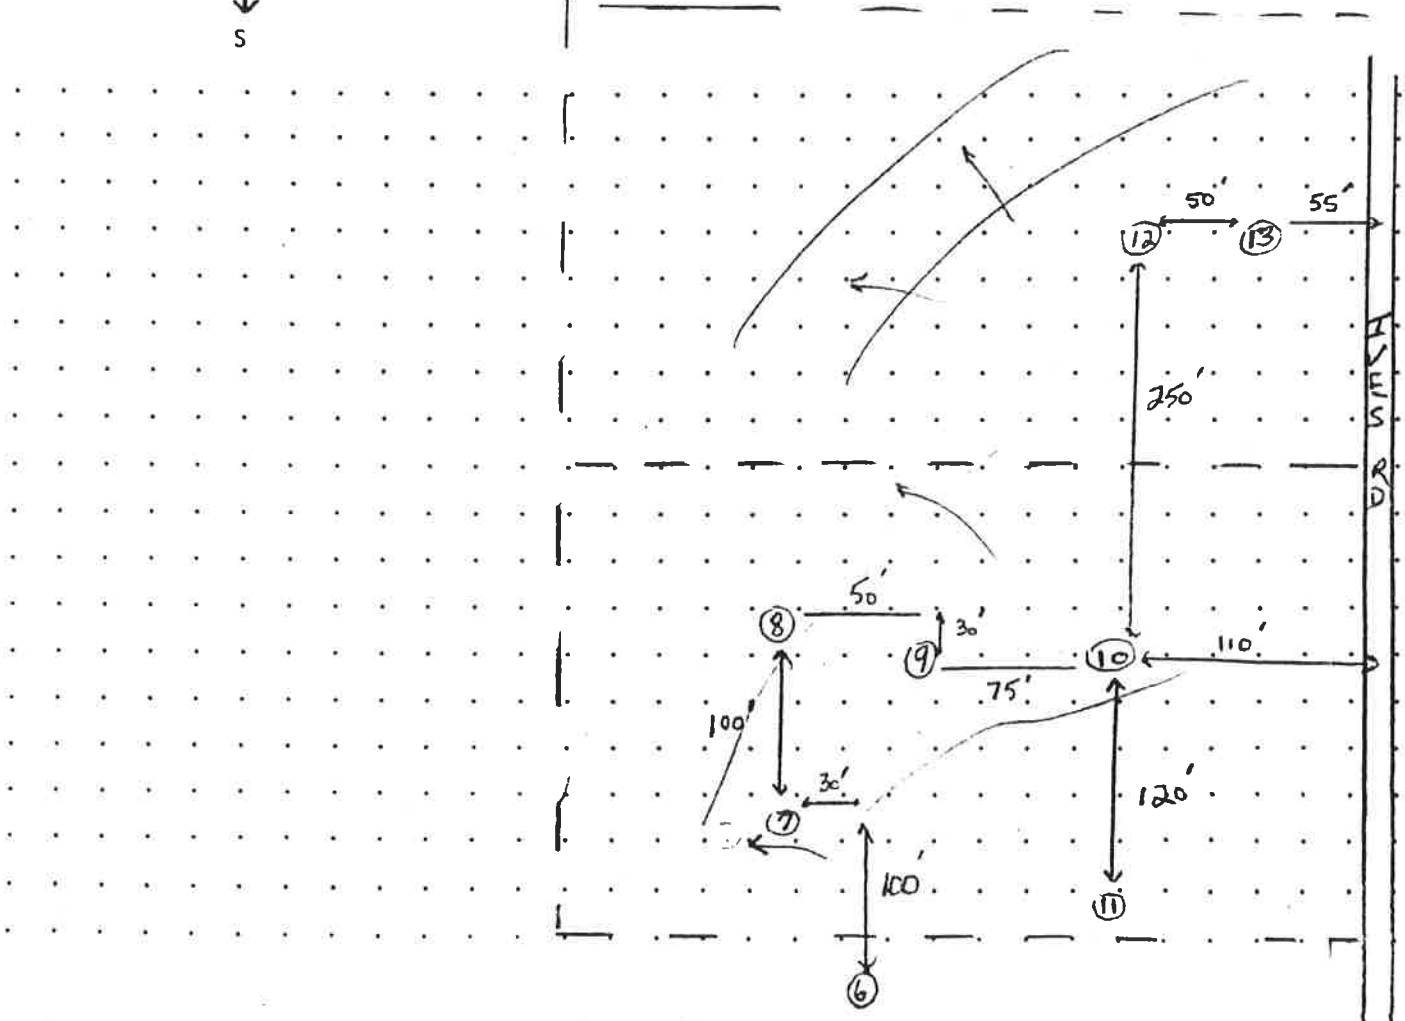

Road Location _____

Permit No. 33-
(after issuance) _____

Test #	6	7	8	9	10
Type of Test	BH	BH	BH	BH	BH
Depth	5 1/2'	4'	3'	4 1/2'	4'
Each test hole located on Plot Plan by number	12" O TS Coarse Sandy & gravelly Loam 2' - Mix of dull L & fine SL & fines 5 1/2' - greyish (Sat) coarse pecky Loam at 5 1/2' WL 64"	12" O TS med S 32" - MT SL 4' - Sat at 38"	12" O TS Coarse Sandy & gravelly L 2 1/2' - 3' - muds Sat at 3' Heavily MT Fine LS at 3'	12" O TS Rocky SL 3' - 4 1/2' - MT grey S MT SL at 4 1/2' WL 4'	12" O dark TS dull L & SL 30" - MT SL 4' -

SOIL TEXTURE

S	Sand	SCL	Sandy Clay Loam	B	Hand Auger Boring
LS	Loamy Sand	SiCL	Silty Clay Loam	BH	Backhoe Cut
SL	Sandy Loam	CL	Clay Loam	TS	Top Soil
L	Loam	C	Clay	(MT)	Seasonal High Water Level (mottling)
SiL	Silty Loam	M	Muck	(WL)	Water Level (saturation)

Limitations of the site that affect use of on-site subsurface sewage disposal:

- ☐ 1) Severely restrictive soil features.
☐ 2) Impervious layer within 48" of ground surface.
☐ 3) High seasonal water level.
☐ 4) Wet depressions or poor surface drainage.
☐ 5) Slope limitations (exceeds %).
☐ 6) Overflow of run-off water from adjacent higher areas.
☐ 7) Insufficient space for replacement of drainfield.
☐ 8) Insufficient isolation distance from _____.

Observations, stipulations: _____

Not ok for conventional

OK to consider alternative treatment

Observer: _____

Sanitarian: _____

N. Banghart R

Date: _____

4-28-98

Test #	11	12	13		
Type of Test	BH	BH	BH		
Depth	3'	4 1/2'	4'		
Each test hole located on Plot Plan by number	12" O TS 3' LSW rocks dull (MT) at 3'	12" O TS 32" Rocky SL Wet Coarse S gravel 4 1/2' WL 50"	12" O TS Fine SL with Rocky Particulate L, LS & S 4' (MT) at 3' WL 4'		

SOIL TEXTURE

S	Sand	SCL	Sandy Clay Loam	B	Hand Auger Boring
LS	Loamy Sand	SiCL	Silty Clay Loam	BH	Backhoe Cut
SL	Sandy Loam	CL	Clay Loam	TS	Top Soil
L	Loam	C	Clay	(MT)	Seasonal High Water Level (mottling)
SiL	Silty Loam	M	Muck	(WL)	Water Level (saturation)

Limitations of the site that affect use of on-site subsurface sewage disposal:

- ☐ 1) Severely restrictive soil features.
- ☐ 2) Impervious layer within 48" of ground surface.
- ☐ 3) High seasonal water level.
- ☐ 4) Wet depressions or poor surface drainage.
- ☐ 5) Slope limitations (exceeds %).
- ☐ 6) Overflow of run-off water from adjacent higher areas.
- ☐ 7) Insufficient space for replacement of drainfield.
- ☐ 8) Insufficient isolation distance from _____.

Observations, stipulations: _____

Unsuitable for conventional
OK to consider alternative treatment

Observer: _____

Sanitarian: _____

M. B. Broughton 25

Date: _____

7-28-95

