


SOIL EVALUATION DATA SHEET

Ingham County Health Department
P. O. Box 30161 Lansing, Michigan 48909

THIS RECORD SHALL NOT CONSTITUTE A PERMIT

Requested by Alexis Coxon
Address 4220 Tumbidge Dr.
Holt, MI 48842
Phone # 517-927-5702

☒ Land Owner ☐ Realtor
☐ Prospective Buyer ☐ Builder
☐ Installer ☐ Other:

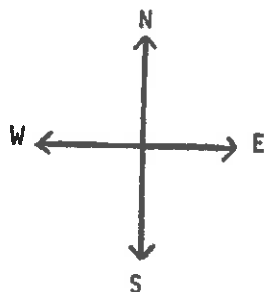

PLOT PLAN

Township Delhi Section 28
Road Location Harper Road West of
Eifert
Subdivision M & B
Lot No. Side of Road N
File Search
Parcel No. 33- 25-05-28-400-032
Soil Survey Sheet No.
Parcel Size 10 acres

* See Attached Map

Road Location Harper RoadPermit No. ~~93~~ 4-17-13-081
(after issuance)

Test #	1	2	3	4	5
Type of Test	BH	BH	BH	BH	BH
Depth	42"	52"	60"	48"	48"
Each test hole located on Plot Plan by number	0-10" TS, SL 10-18" SL NMT 18-42" CL MT@ 18"	0-10" TS, SL 10-18" SL, NMT 18-24" SCL MT@ 18" 24-52" CL, MT	0-12" TS, LS 12-42" LS, NMT 42-60" L-CL MT@ 42"	0-10" TS, L 10-48" CL MT@ 18"	0-10" TS, L 10-48" CL MT@ 18"
	6	7			
	0-6" TS, LS 6-42" LS, NMT 42-60" L, MT@ 42" WL@ 58"	0-6" TS, LS 6-36" LS, NMT 36-40" L MT@ 36"			

SOIL TEXTURE

S Sand
 LS Loamy Sand
 SL Sandy Loam
 L Loam
 SiL Silty Loam
 SCL Sandy Clay Loam
 SiCL Silty Clay Loam
 CL Clay Loam
 C Clay
 M Muck
 B Hand Auger Boring
 BH Backhoe Cut
 TS Top Soil
 (MT) Seasonal High Water Level (mottling)
 (WL) Water Level (saturation)
 NMT Not mottled

Limitations of the site that affect use of on-site subsurface sewage disposal:

- ☐ 1) Severely restrictive soil features.
☐ 2) Impervious layer within 48" of ground surface.
☐ 3) High seasonal water level.
☐ 4) Wet depressions or poor surface drainage.
☐ 5) Slope limitations (exceeds %).
☐ 6) Overflow of run-off water from adjacent higher areas.
☐ 7) Insufficient space for replacement of drainfield.
☐ 8) Insufficient isolation distance from _____

Observations, stipulations: This site is suitable for conventional wastewater treatment. Drop boxes may need to be used to keep lines shallow along the slope.

Observer: Alexis CoxonSanitarian: Randy FedewaDate: 5-8-13